

Running Procedure for Cobra® SP Connection

Procedure No: FT-RP-005

Rev: 06



Approvals

Revised By	Daniel Ruiz, Jeff Callahan (OFSi) & Nilton Garcia (Fermata Connections)	08/18/2025
QA Approval	Israel Martinez (Fermata Connections)	08/18/2025
Approved By	Nilton Garcia	08/20/2025

Revision Control

REV	Description of Changes	Date Issued
06	Revised to include knurling verification, Field service tech requirements	08/20/25

All material contained in this brochure is for general information only. This material should not, therefore, be used or relied upon for any specific application without independent competent professional examination and verification of its accuracy, suitability, and applicability. Fermata® Connections, LLC does not assume any responsibility or liability for any loss, damage, injury resulting from the use of information and data

Running Procedure for Cobra® SP Connection

Procedure No: FT-RP-005

Rev: 06

1. General Running Procedure

- 1.1 Refer to General Running Procedure No. FT-RP-000 latest revision.
- 1.2 Cobra® SP requires Slip Type Elevators to run.
- 1.3 Handling Plugs and Stabbing Guide are required for running.
- 1.4 Fermata® strongly recommends the use of a Fermata® certified and trained thread rep service company during all Fermata® Connections casing runs. If a Fermata® certified/trained thread rep service is not used, the operator is responsible for approving and ensuring that all connection make-ups meet Fermata® make-up criteria.

2. Thread Compound Application

- 2.1 Fermata® recommends the use of Fermata® Constrictor® Advanced Thread Sealant for all sizes on the pin connection.



Figure 1: Fermata® Constrictor® Advanced Thread Sealant

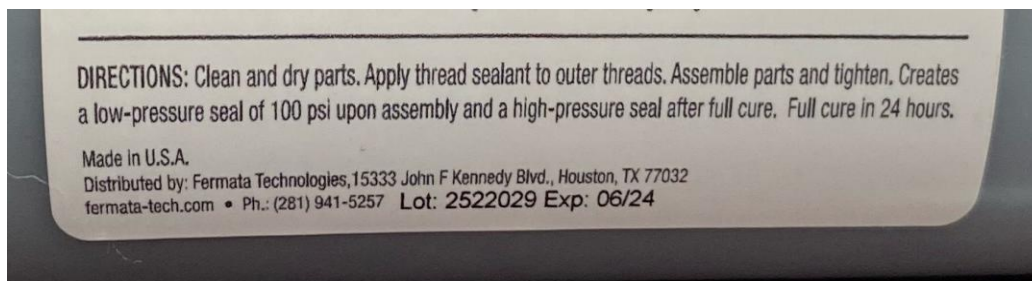


Figure 2: Example of Fermata® Constrictor® Advanced Thread Sealant Label Expiration Date

Running Procedure for Cobra® SP Connection

Procedure No: FT-RP-005

Rev: 06

2.2 The amount of applied thread compound will depend on the size and weight configuration of the connection.

2.3 Using a measuring device, apply the amount of thread sealant specified in Table 1 to the pin threads. Adjust thread compound amount by up to 2 mL as needed to achieve comparable application to that in Figure 3. DO NOT apply any thread compound on the box connection. Under certain circumstances dope application may be altered only if approved by Fermata® engineering.

Table 1: Constrictor® Advanced Thread Sealant Amount

OD (inches)	Volume (mL)
2-3/8"	1
3-1/2"	1.25
4"	2.5
4-1/2"	3
5"	3.5
5-1/2"	4
7	5
7-5/8"	6.25
8-5/8"	6.25
9-5/8"	7.5
10-3/4"	9
18-5/8"	17

2.4 The use of a fine bristle mustache or 1" paint brush is recommended to best control the application of thread sealant. The brush should be clean and free of any water. Water that is on the brush or connection must be completely removed before the application of sealant. As the thread compound brush becomes more saturated with compound, less is required to achieve full coverage compared to when the brush was new.

Running Procedure for Cobra® SP Connection

Procedure No: FT-RP-005

Rev: 06



Figure 3: Example of Proper Thread Compound Application of the Pin Connection

- 2.5 Ensure to not overapply thread compound. When using a measuring spoon, level the spoon by scraping the top with a flat edge if the volume increment is equivalent to the spoon (example: if 5mL is specified in the running procedure and a 5mL spoon is used for measuring, level the spoon). Use the applicator brush to clean out the spoon and spread the compound evenly across all threads. Do not apply any compound past the base of the make-up indicator.
- 2.6 Excessive thread compound can cause dope squeeze and/or yielding on a connection. If dope squeeze or yielding is observed, reduce the amount of thread compound. It is recommended to start with a reduction of 30%. Ensure that the connection still maintains light, full coverage. The following are 2 unacceptable graphs due to excessive compound.



Figure 4: Yielding

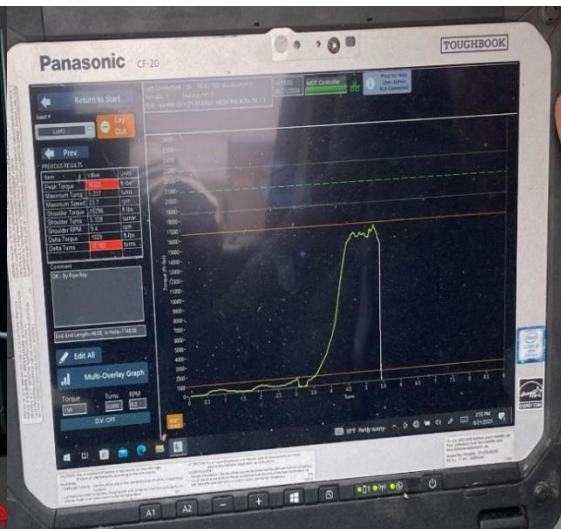


Figure 5: Dope Squeeze

Running Procedure for Cobra® SP Connection

Procedure No: FT-RP-005

Rev: 06

- 2.7 Due to thread compound transfer between the thread and the thread protector, re-distribute the thread compound on the pin threads before stabbing into the box end, to ensure even thread compound coverage of the connection after removing the pin end thread protector.

3. Connection Compatibility

- 3.1 Cobra® SP does **NOT** have compatibility with differing weights within the same OD.

4. Make-Up

- 4.1 The Field Service Technician must ensure that he has the correct and latest data sheets.
- 4.2 The Field Service Technician will apply all thread compound per the manufacturers' recommendations prior to starting the casing run. If any joints are not able to have thread compound applied on the pipe rack due to the way the pipe is arranged, the Field Service Technician will apply the thread compound as they are brought to the rig floor or as the ends are accessible on the pipe rack during the run.
- 4.3 The Field Service Technician must remain on the tower or rig floor to accept all make-up graphs and notify the rig crew that he will be on the ground applying thread compound on the pipe rack.
- 4.4 During the running of the casing, the Field Service Technician is responsible for approving all make-up graphs and verifying the placement of the Constrictor® lock point. If the movement of cables, slips, or binding of elevators is observed, all efforts must be made to fix the issue and shall be noted in the comments of the make-up graph and the field service report.
- 4.5 Fermata® recommends setting the scale (X axis) of the make-up graph to 5-8 turns to obtain a proper make-up profile.
- 4.6 An encoder should be used and not a proximity switch for counting rotations. Generally, proximity switches do not provide adequate pulses per revolution. A 500 pulse per revolution should be the minimal pulses referenced per turn.
- 4.7 Fermata® recommends targeting the optimum make-up torque listed on the current connection data sheet. Any make-up torque between the minimum and maximum make-up torque is acceptable, but the optimum make-up torque is ideal for most conditions and common equipment. Add 10% to all specified make-up torque values when using a thread locking compound.
- 4.8 For casing sizes larger than 13-3/8", the use of a single-joint compensator to aid in the lifting of the casing to minimize the risk of thread galling and cross-threading during stabbing, make-up and break-out of the connection is highly recommended.

Running Procedure for Cobra® SP Connection

Procedure No: FT-RP-005

Rev: 06

- 4.9 Before the first connection make-up, set the dump valve to the optimum torque, and test on the pipe body to ensure proper tong engagement and that the pipe integrity is not compromised.
- 4.10 Make-up the first connection to the optimum torque, draw a line across the pin and box, and re-apply the optimum torque (double bump).
- 4.11 If movement past 0.5" is observed, reapply optimum torque +20% (This may exceed maximum make-up torque, but is acceptable, provided no yielding is observed and the torque is not compromising the pipe body).
- 4.12 Repeat 4.10 & 4.11.
- 4.13 Movement is an indication of excess thread compound. If observed, review the amount of thread compound applied and reduce the amount.
- 4.14 Continue making up the string to the higher torque value, if necessary.
- 4.15 Spin in the connection in high gear at Revolutions Per Minute (RPM) at or below that listed in Table 2. A maximum of 3 turns per revolution are recommended to prevent a false lock point while running in high gear.
- 4.16 Move to low gear prior to the Constrictor® lock point (see Figure 6) and keep the RPM at or below that listed in Table 2.
- 4.17 RPM may occasionally be adjusted based on makeup profile if approved by Fermata® Field Service Management or Engineering.
- 4.18 The following (Table 2) is the recommended maximum make-up RPM.

Table 2

Pipe Diameter	High Gear not to exceed	Low Gear not to exceed
4-1/2" to 5-1/2"	20 RPMs	5 RPMs
7" to 7-5/8"	15 RPMs	5 RPMs
8-5/8" – 10-3/4"	10 RPMs	3 RPMs
13-3/8" & Higher	5 RPMs	3 RPMs

- 4.19 Verify the make-up result against the torque-turn graph to ensure that there were no abnormal make-up scenarios that could affect the make-up and performance of the connection.
- 4.20 The Constrictor® Lock Point is the point on the graph where the torque-turn slope begins to change from curved to linear. It is required to be between 5% and 80% of makeup torque. See Figure 6 and 7.
- 4.21 Once the Constrictor® Lock Point is achieved, the graph should continue a linear profile with no decrease in slope. See figures 8, 9, and 10 for examples of unacceptable graphs where a decrease in slope is observed after the Constrictor® Lock Point.

Running Procedure for Cobra® SP Connection

Procedure No: FT-RP-005

Rev: 06

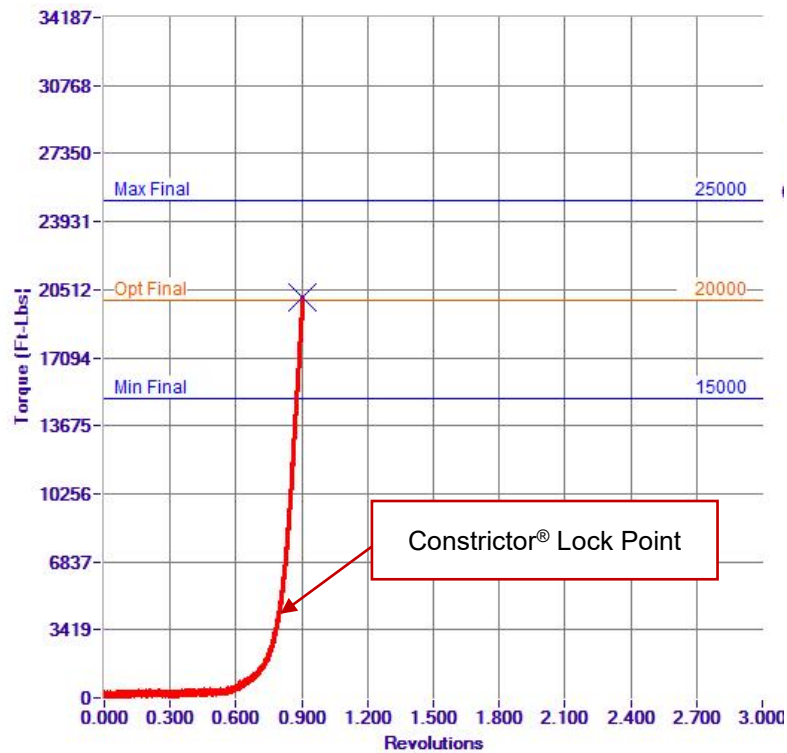


Figure 6: Example of a Proper Make-up Graph & Constrictor® Lock Point

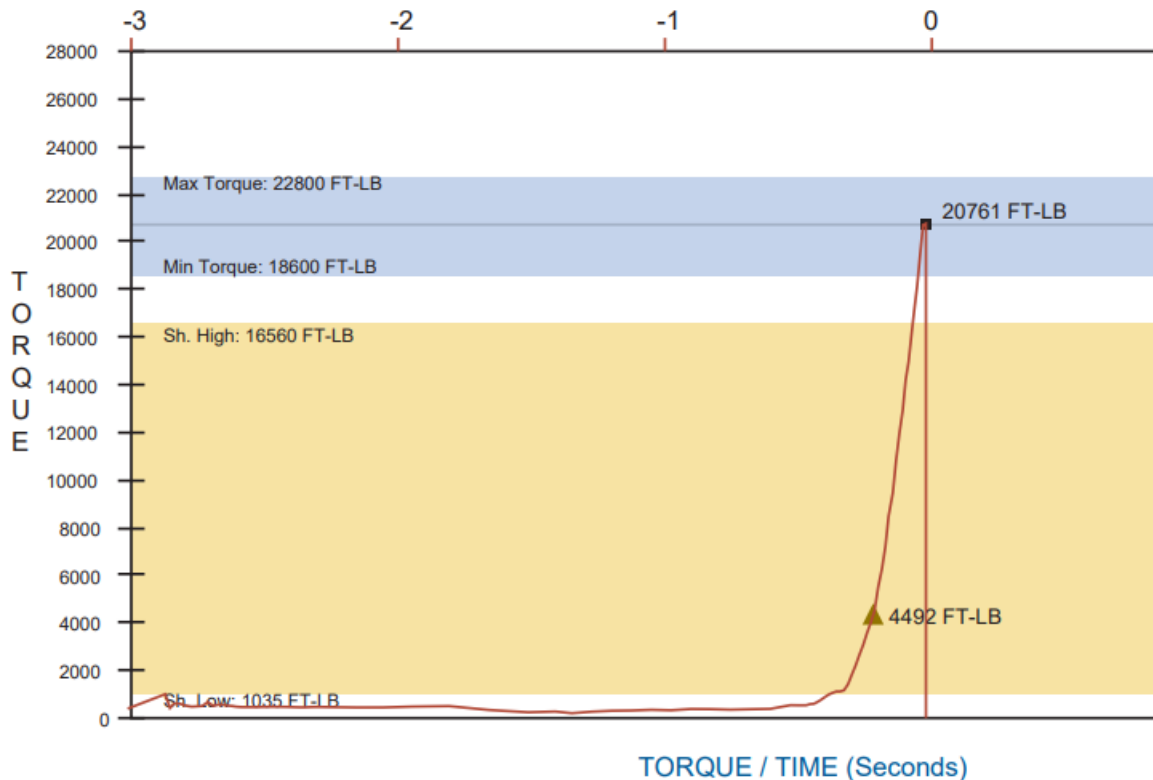


Figure 7: Example of an Acceptable/Proper Cobra® SP Connection Make-Up

Running Procedure for Cobra® SP Connection

Procedure No: FT-RP-005

Rev: 06

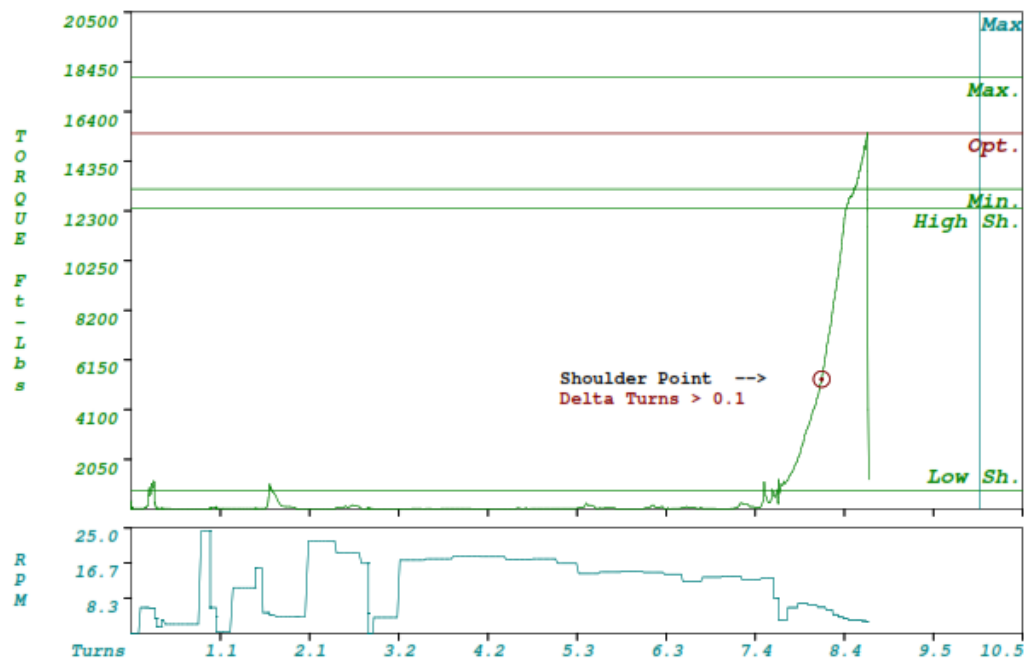


Figure 8: Unacceptable Make-Up Graph Example 1

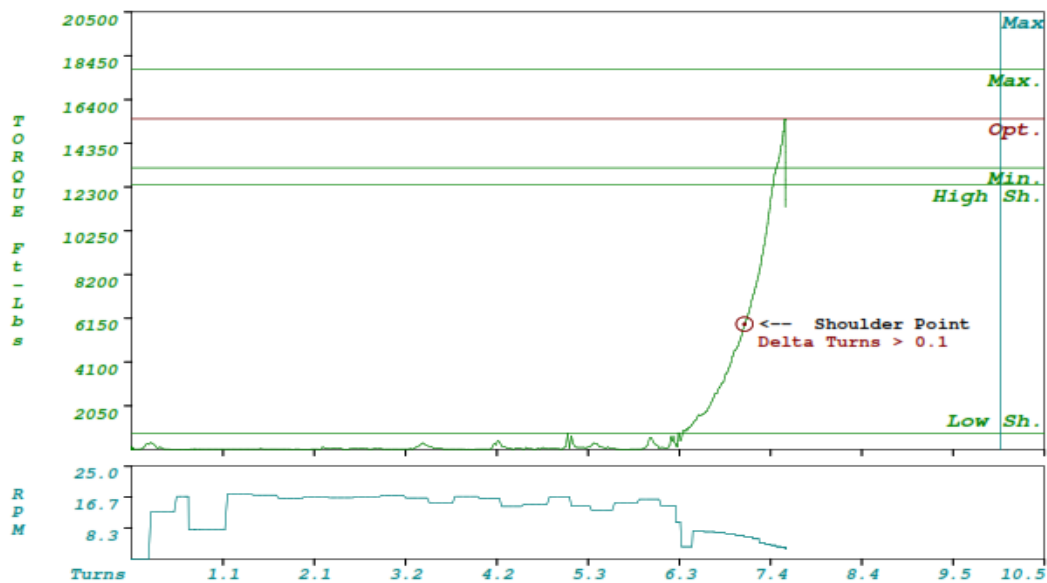


Figure 9: Unacceptable Make-Up Graph Example 2

Running Procedure for Cobra® SP Connection

Procedure No: FT-RP-005

Rev: 06

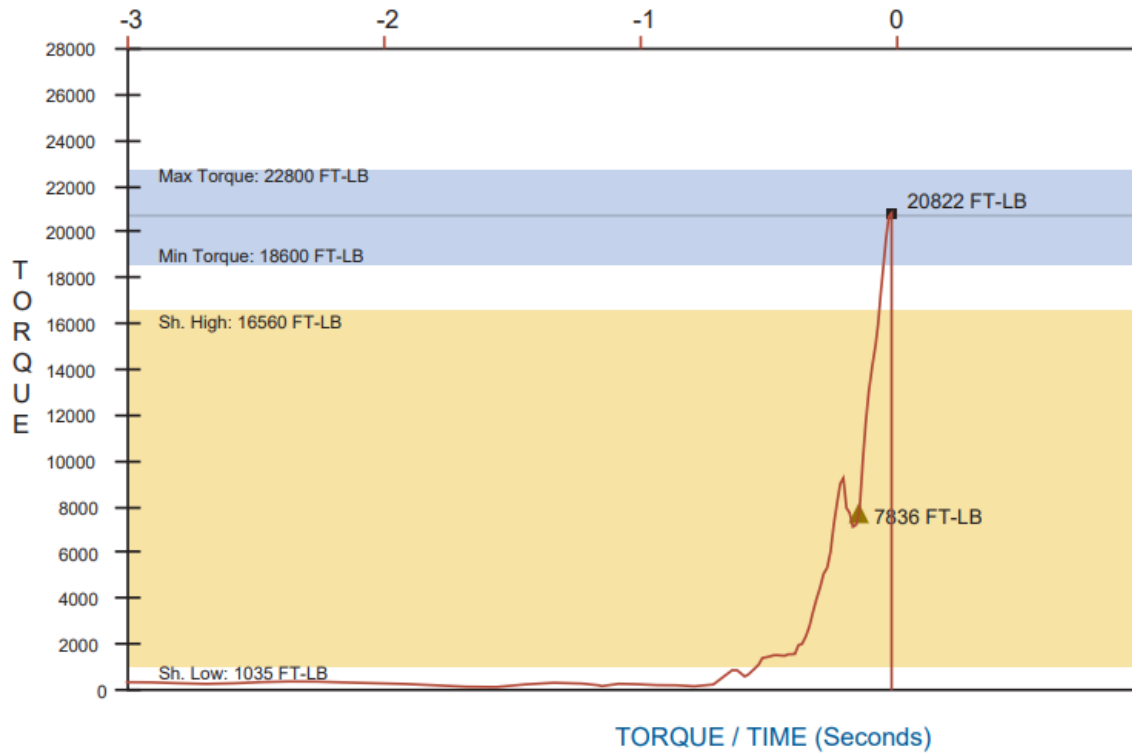


Figure 10: Example of an Unacceptable Cobra® SP Connection Make-Up

4.22 Verification of proper Cobra® SP connection make-up can be made by checking the triangle stamp or knurling.

- For connections with a triangle stamp, the base of the triangle shall be aligned within $\pm .062$ " of the box face (Figure 11). A 1" wide X 24" long white paint stripe is applied to the field end pin to aid in location the triangle stamp location (Figure 12).



Figure 11: Example of Triangle Stamp Position After Make-Up

Running Procedure for Cobra® SP Connection

Procedure No: FT-RP-005

Rev: 06



Figure 12: Example of Proper Triangle Stamp Position After Make-Up

- Connections with knurling, the box face shall fall/lie anywhere inside the knurl band tolerance criteria (Figures 13 & 14).
- Knurl band acceptable coverage is 50% - 100% of pipe circumference.

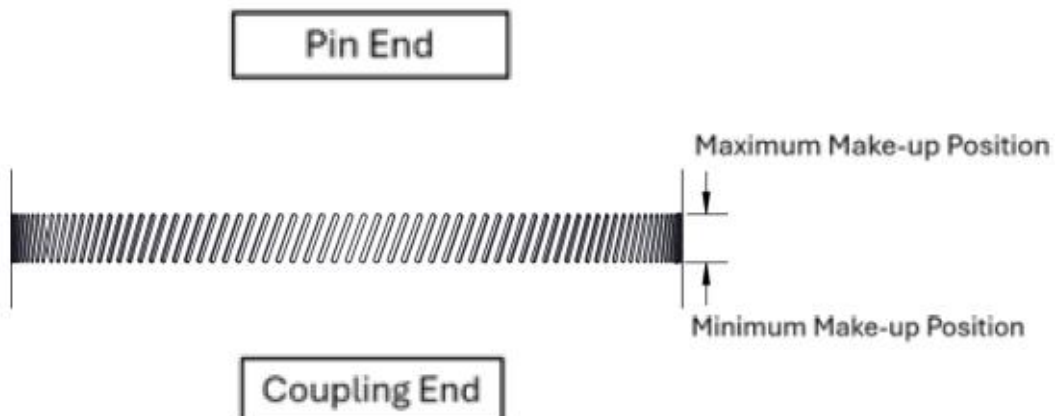


Figure 13: Knurl Band Tolerance Criteria

Running Procedure for Cobra® SP Connection

Procedure No: FT-RP-005

Rev: 06

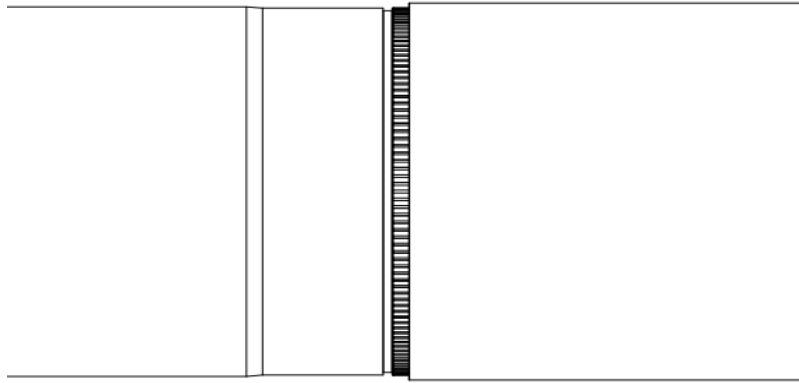


Figure 14: Example of Knurling Area After Make-Up

5. Downhole Rotation

- 5.1 The maximum operating torque listed on the latest revision of the connection data sheet is the maximum torque allowed for downhole rotation, unless reviewed and approved by Fermata® Engineering. The speed should not exceed 40 RPM.
- 5.2 RPM's and operating torque may be evaluated and adjusted on a case-by-case basis, if approved by Fermata® Engineering.
- 5.3 Take care to gradually increase or decrease rotation speed and torque to prevent potential dynamic loading scenarios.

6. Break out & Inspection of Connection

- 6.1 Verify the back-up tongs are equipped with the appropriately sized dies prior to break-out of the connection.
- 6.2 Place the back-up tongs on the pipe body below the threaded area of the box.
- 6.3 Break-out the connection in low gear to ensure adequate torque capability.
- 6.4 Keep break-out speed low to prevent galling (preferably 5 RPM or less)
- 6.5 Break-out the connection slowly until the pin "jumps", indicating disengagement.
- 6.6 Use a stabbing guide prior to disengagement to prevent damage to the connection.
- 6.7 Alignment is equally important during the connection break-out as during make-up. Verify alignment prior to break-out of the connection.
- 6.8 If it is necessary to re-run the connection, make sure to fully break-out the connection, remove all thread compound and debris, inspect the connection for damage (galling/gouging), and follow the make-up procedure outlined in Section 4.

Running Procedure for Cobra® SP Connection

Procedure No: FT-RP-005

Rev: 06

- 6.9 When necessary to lay down the string, the connection must be stored and covered with an approved storage compound and covered with the proper sized thread protectors. Ensure that the thread protectors are clean and free of grime, debris and foreign contaminants.
- 6.10 Properly mark the joints in accordance with the rig repair / rejection report (Figure 15) and notify your immediate supervisor if joints were laid down.
- 6.11 All used, rejected, and/or repairable pipe left at the rig location must be identified, tagged and categorized based on the chart show in Figure 15, and must be submitted to Field Service Management as soon as possible via email.

Summary of Pipe left on Rig Location		
Customer: _____		Rig: _____ Well Name: _____
String 1	String 2	
		Prime Joints , conduct VTI leave instructions to apply storage compound prior to having thread protectors placed back on. (Joints that never left the pipe rack)
String 1	String 2	
		Rig Returns , identified by a 1 White band near mill end & 1 Yellow band at repairable end / area. (Joints that were made up never went below the rig floor, broken out, laid down, and passed VTI.)
String 1	String 2	
		Used Pipe , identified by a 1 Orange band 6 inches each side of the defect, damage, or made up end and near the mill end. (Joints failed VTI or went below rig floor.)
String 1	String 2	
		Rejected Pipe , identified by a 1 Red band 6 inches each side of the defect, damage, or made up end and near the mill end. (Joints rejected with signs of galling, pitting, or other damage.)

Figure 15: Pipe Classification Summary Example